

Date: Friday, 23/05/2008 9:53:37 AM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKIDTUBE ASSEMBLY
Job Number :	39436		
Estimate Number :	10022		
P.O. Number :		Part Number :	D205634011
This Issue :	23/05/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	N/A
First Issue :	1/1	Project Number :	N/A
Previous Run :	39435	Drawing Revision :	N/A
		Material :	
Written By :		Due Date :	10/06/2008
Checked & Approved By :	JUD 08.5.23	Qty:	1 Um: Each
Comment :	Est Rev:P 02.08.28 Removed QC5 from Step 5 KJ		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D205-634-011

CHG005

6 08/06/09 08.5.27 JLD

2.0	39436A	SKID TUBE ASSEMBLY
-----	--------	--------------------



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B 39436A

SU

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K10003	Saddle, D205-634-011
-----	--------	----------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	K10003	Saddle Kit	38649

8/6/9

SU

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

5 08/06/09

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:00 AM
 User: Julie Lecocq

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: SKID TUBE ASSEMBLY
Job Number	: 39436A		
Estimate Number	: 10023		
P.O. Number	:	Part Number	: D205634041
This Issue	: 23/05/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D2580 REV D
First Issue	: / /	Project Number	: N/A
Previous Run	: 39435A	Drawing Revision	: D
Written By	:	Material	:
Checked & Approved By	: <u>JUD 08.5.23</u>	Due Date	: 10/06/2008
Comment	Est Rev: N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev: O 06.02.28 Added paperwork EC Est Rev: P 07-07-09 SS Wearplates & Gaskets JLM		

Qty: 1 Um: Each

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

N/A

2.0	D25001190	Ext'n -1" Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	37544

ET 08-05-26

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-394358

AWM 8-5-26

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

ET 08-05-26

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 8-5-27

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M107803

Sikaflex expire date: 8-10-01

Start Time: 3:40 Date: 8-5-27

Fin Time: 3:40 Date: 8-5-28

ET 08-05-27

ANM
8-5-28

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

ET 08 05-28

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

SL 8-5-28

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08/05/28

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	BE 08/05/29

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	BE 08/05/29

BE 08/05/29

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

M107877

BE 08/05/29

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M107877

BE 08/05/29

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

SL85-30

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

11
3-6-2

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/06/02 *SC*

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/06/02 *SC*

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/06/03 *(V)*

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 107925.

START TIME:

2:15

OVEN TEMPERATURE:

320°

FINISH TIME:

2:45

BR 0806-03

(D)

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-06-06

(K)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: *1338395*

SL

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: *M100188*

SL

08-06-06

(K)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M1104885

YH

21.0

ALS71032130

Insert



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M1105819

YH

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: (22x) => M108161 (28x) => M107971

YH

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M1108077

YH

24.0

D356613

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B332744

YH

25.0

D35665

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B339237

YH

26.0

D35661

Gasket



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B338681

YH

08.06.06 (20)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D356413

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1338253

911

28.0

D356411

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1339133

911 *

29.0

D35649

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1338656

911

30.0

D35645

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1334235

911

31.0

D25943

O-Ring, 205 Skidtube



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 1329908

911

32.0

D25941

Plug, 205 Skidtube



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 1337926

911

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M107804

911

08-06-06

911

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 23/05/2008 9:54:01 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 39436A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

✓ Sikaflex expire date: 08/10

✓ 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

✓ 3-Inspect for foreign object per QSI 024

✓ 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M107804
✓ Sikaflex expire date: 08/10

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M107892

JS 08-06-06

(X)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08/06/06



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



(1x)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PPP

39436A

SC

8/6/9

SU

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/06/10

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



08-06-10

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART**RELEASED**
07-06-28 #

DESIGN #	DRAWN BY RH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 3943614

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

NO. 156

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: 39209 A
Part number: D209 669 043
Description: Skid tube Cobra
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]


UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]


Qualifier Pat. Duval Date of Test Coupon 08-05-22
Welder Barclay Elliot Date of Test Coupon 08/05/22

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

DETAIL A
SCALE 5:24

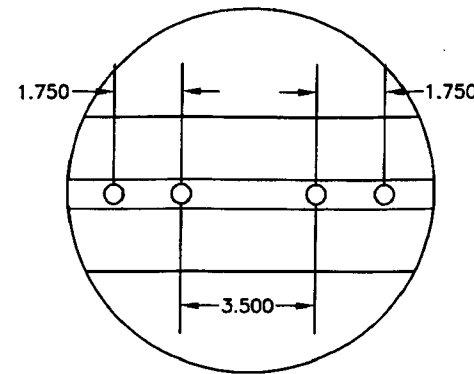


DETAIL B
SCALE 5:24

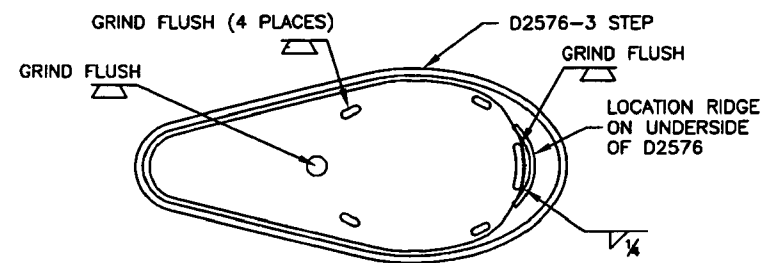


RELEASED
07-06-28

DETAIL C
SCALE 5:24

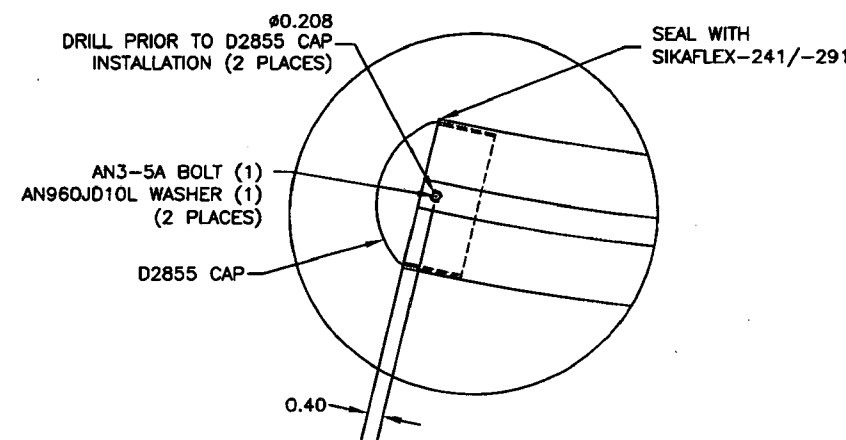


SECTION D-D
SCALE 5:24

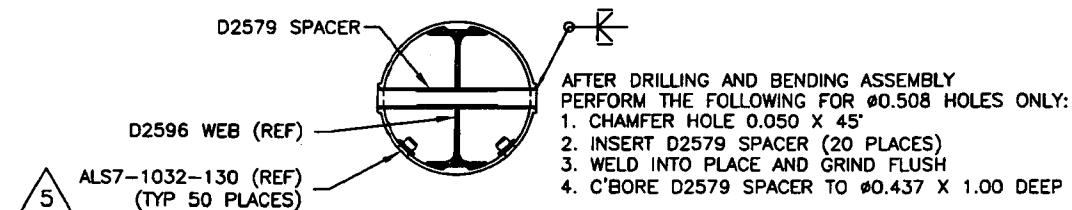


D2580-041 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4


D2580-1 DRILLING DETAIL

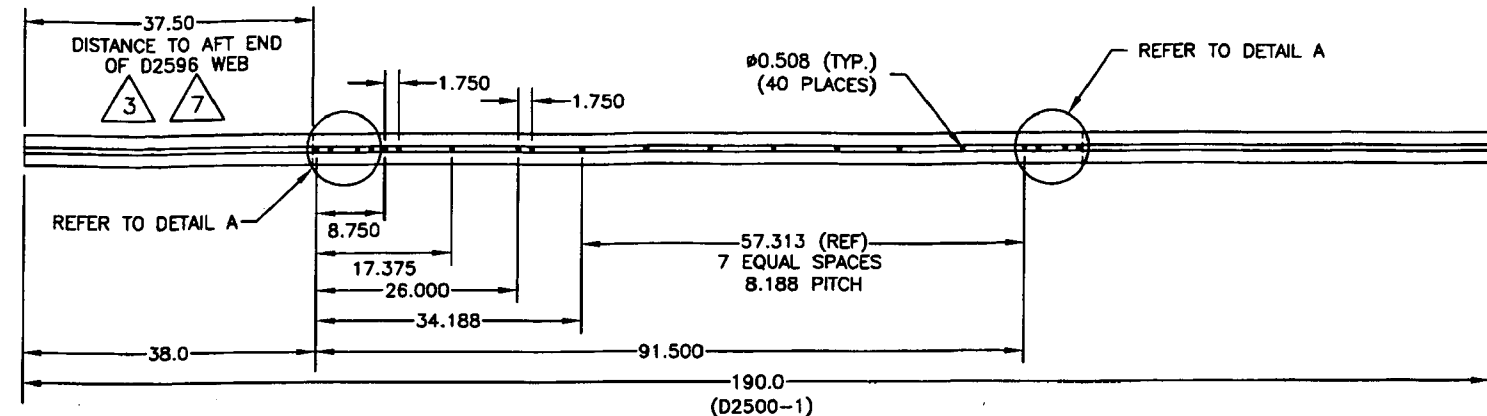

D2580-1 BENDING AND CUTTING DETAIL

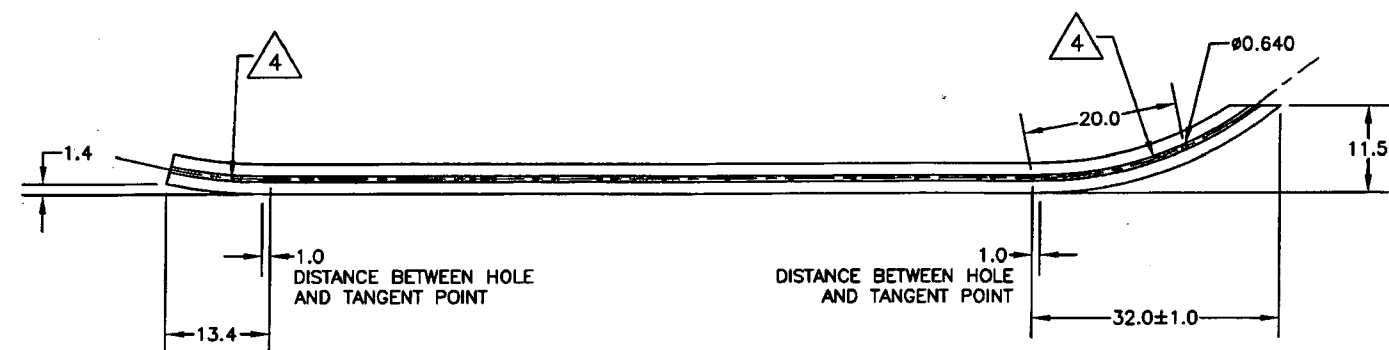

D2580-041 ASSEMBLY DETAIL

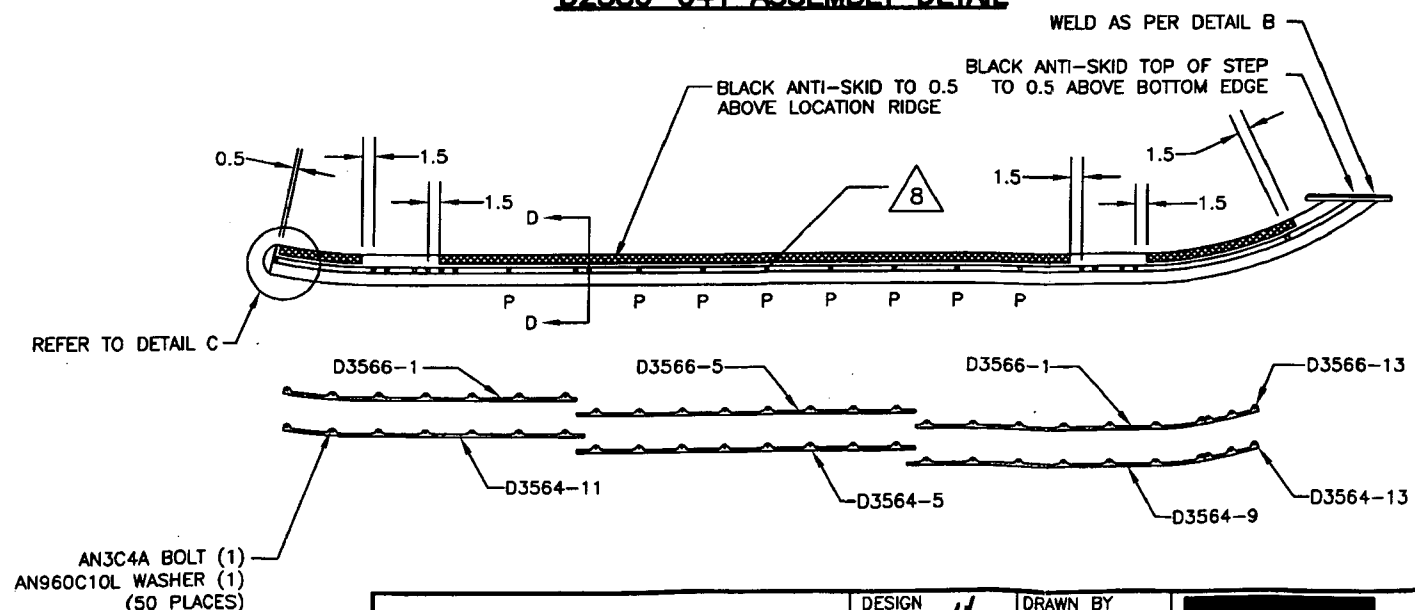

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 394307

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD. HAMKESBURY, ONTARIO, CANADA
CHECKED	APPROVED	DRAWING NO. D2580	REV. D SHEET 2 OF 3
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24	

Diagram illustrating the cross-section of a circular beam with four vertical reinforcement bars. The diameter is 16 inches. The distance between the centerlines of the two outer bars is 3.500 inches. The distance from the centerline of an outer bar to the inner face of the concrete is 1.750 inches. The bars are shown with hooks at the top and bottom.

RELEASED
07 Dec 28

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the component with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

Diagram illustrating the rear view of the cap assembly. The diagram shows a circular cap with a central hole. A bolt and washer are shown being installed through the cap. The following components and dimensions are labeled:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-5A BOLT (1)
- AN96QJD10L WASHER (1) (2 PLACES)
- D2855 CAP
- SEE NOTE ii)
- 0.40

D2579 SPACER

D2596 WEB (REF)

ALS7-1032-130 (REF)
(TYP 50 PLACES)

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR .0508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X .45"
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO .0437 X 1.00 DEEP

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

[illegible]

(MAKE FROM D2380-1 DRILLING DETAIL)

Technical drawing of a propeller shaft with the following dimensions and callouts:

- Overall length: 51.340
- Distance from left end to first hole: 5.985
- Distance between first and second hole: 5.338 (REF)
- Distance from second hole to third hole: 3.630 (REF)
- Distance from third hole to fourth hole: 39.580
- Distance from fourth hole to fifth hole: 5.915
- Distance from fifth hole to sixth hole: 20.0
- Distance from sixth hole to seventh hole: 32.0 ± 1.0
- Distance from seventh hole to eighth hole: 1.0
- Distance from eighth hole to ninth hole: 1.0
- Distance from ninth hole to tenth hole: 13.4
- Distance from tenth hole to eleventh hole: 1.4
- Hole diameters:
 - 8 holes: $\varnothing 0.508$ (8 PLACES)
 - 1 hole: $\varnothing 0.640$
- Callouts: 4 (four locations)

D3566-070 ASSEMBLY DETAIL

WELD AS PER DETAIL F

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

NO C'BORE NO PLUG

8

0.5

1.5

REFER TO DETAIL G

H

P

NO C'BORE NO PLUG

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13


AN3C4A BOLT (1)

AN960C10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 3943elt

COPYRIGHT © 1996 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN <i>RH</i>	DRAWN BY <i>RH</i>		DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
	CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. SHEET 3 OF
	DATE 07.02.27	TITLE 205 SKIPTUBE ASSEMBLY		SCALE 1:2

